

119-00036 SHP_01 Smart HUB Service Bulletin: New Firmware Release (v1.1.3r655)

Product Details

- Part No. SHP_01
- Rev No. 1.2 onwards

Service Bulletin History

Document No.	Rev No.	Description	Effective Date	Jira No.
119-00036	1.0	Firmware release	19 Jun 2023	 SHC-669 - Top Level task for SHC 1.1.3 FW Release DONE

Planning Information

Reason

Firmware v1.1.3r655 is a release incorporating a bug fix for mounting FAT32 USB sticks which would fail to mount correctly in v1.1.2.

Prerequisites

The Firmware is suitable to be installed on Flightcell SHP_01 Smart Hub Revision 1.2 or greater.

Description

The new release of firmware for the Flightcell SHP_01 contains several improvements to ambient audio recording to reduce audio overruns.

The firmware release is issued as a single package file named smarthub-v1.1.3r655-upgrade.package

The firmware packages can be downloaded from our web page

<https://www.flightcell.com/support/firmware>.

Follow the upgrade instructions outlined in the Accomplishment Instructions section to upgrade your unit.

Compliance

This firmware upgrade is Recommended.

This firmware is only suitable to be installed on Flightcell SHP_01 units.

Upgraded SHP_01 Revision 1.2 units and above must be marked/labelled on the outside of the unit with the appropriate software modification status letter from the following table:



Product Revision	Software Modification Status Letter
1.2	C

Approval

This service bulletin contains no modification information that revises the approved configuration and therefore does not require governmental or other regulatory agency approval.

Manpower

The manpower required to accomplish the procedures described in this service bulletin is detailed below:

Firmware Updates	20 Minutes
Verification	2 Minutes
Total Time Required:	Approx 22 Minutes

Accomplishment Instructions

System Firmware Upgrade

Before commencing the upgrade:

1. Download the correct firmware package file directly from: <https://www.flightcell.com/support/firmware> and save it to your local PC or laptop hard drive.
2. Ensure there is enough battery power to run the Smart Hub for at least 1 hour (Smart Hub draws approximately 0.28A at 28VDC).

To perform the upgrade:


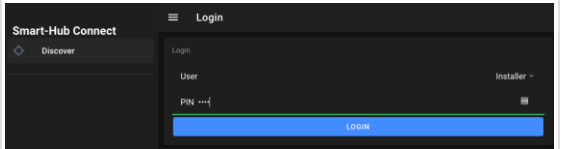

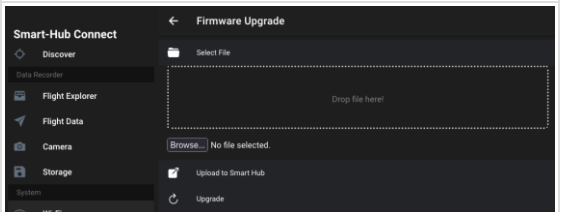
Upgrading the Smart Hub using a USB memory stick:

Step	Description
1	Copy the downloaded firmware package file to a USB memory stick. 1. The firmware package file must be copied to the root directory on the USB stick. 2. The firmware package file must be the only file with the extension .package on the stick.
2	Insert the stick into the bottom of the two stacked USB ports on the front panel.
3	After a few seconds a screen will appear saying USB Drive Mounted and asking user to long press to download flight data
4	Short press the button to advance to the upgrade screen

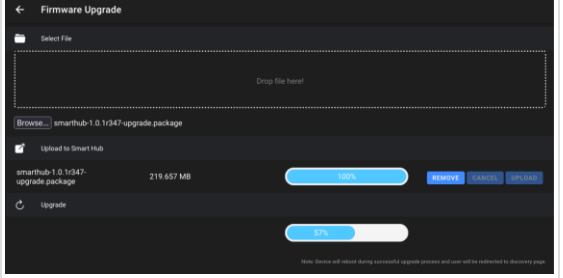


Step	Description
5	Long press the front panel button to commence the upgrade
6	Long press again to confirm the upgrade
7	Follow the prompts on the Smart Hub display.

Upgrading the Smart Hub using Smart Hub Connect:

Step	Description	
1	Connect a laptop via ethernet cable to the front panel ethernet port	
2	Open a web browser and in the address/URL/location bar, enter the IP address: 192.168.16.1	
3	If a picture of a Smart Hub does not automatically appear in the auto-detected Smart Hub pane, then click on Discover and wait for the Smart Hub to appear.	
4	Click on the picture of the Smart Hub and login as installer	
5	Navigate to the About page and under version information, check the firmware version	
6	Select the Upgrade button to proceed	
7	Select the firmware package file. Either: 1. Select Browse and locate where you copied the firmware package and select the file (by default, it would have been copied to your downloads folder). 2. Drag and drop the package file from another file explorer window into the 'Drop file here' boxed area.	
8	Click on UPLOAD then wait while the package is transferred to the Smart Hub	



Step	Description	
9	Once the file has been fully uploaded the upgrade process will start automatically.	
10	After the upgrade, the Smart Hub will reboot automatically.	

Verification

After the upgrade process has completed, and the Smart Hub has rebooted, verify that the firmware upgrade has completed successfully.

Using the Smart Hub Front Panel:

1. Check the current Smart Hub firmware by pressing the button to cycle through until the diagnostics screen.
2. Long press the button to display the diagnostics screen and verify the displayed firmware

Using Smart Hub Connect:

1. After being redirected to the Discovery area, wait for the Smart Hub to fully reboot before re-discovering it.
2. Then follow instruction steps 4-10 above and check that the new firmware version is now v1.1.3r655.

Update nameplate

Label the unit with the appropriate Modification Status Letter. See the Compliance section above for details.

Approval

This service bulletin contains no modification information that revises the approved configuration and therefore does not require governmental or other regulatory agency approval.

Form No. F069 (R1) Effective Date: 26 Sep 2022

